
ADVANCED HIGH CEILING METE QR 4" Cylinder Series - Adjustable Cable(0-10V / Triac)

M IMPORTANT SAFETY INFORMATION. READ AND FOLLOW ALL SAFETY INSTRUCTIONS

IMPORTANT SAFETY INFORMATION. READ AND FOLLOW ALL SAFETY INSTRUCTIONS. Before wiring to power supply and during servicing or relamping, turn off power at fuse or circuit breaker. All servicing or relamping must be performed by qualified service personnel. Product must be grounded to avoid potential electric shock or other potential hazard. Product must be at locations and at heights and in a manner consistent with its intended use, and in compliance with Electrical Code and local codes.

SAVE THESE INSTRUCTIONS FOR FUTURE REFERENCE.

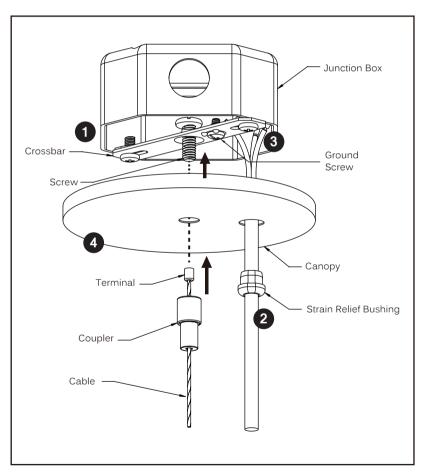

Step 1

Secure the crossbar to the 4" octagonal box (by others) designed to support the weight of the fixture.

Step 2

Lock the strain relief bushing to the power cord with allowance for wiring connections, and thread the power cord through the canopy wire hole.

Step 3

Connect the Green ground conductor to the ground screw on the crossbar, the line voltage to the Black conductor, and the neutral to the White conductor. For 0-10V dimming option, connect the two remaining conductors (Date+ to Purple conductor and Data- to Gray conductor).

* Make all connections with UL approved connectors.


Step 4

Thread the cable through the coupler with the terminal side on top. Slide the coupler up to the canopy and secure with the screw on crossbar.

INC04A01-17V4 | Page 1 of 3

*METEOR LIGHTING reserves the right to make changes to this product at any time without prior notice and such modification shall be effective immediately.

ADVANCED HIGH CEILING METE R 4" Cylinder Series - Adjustable Cable(0-10V / Triac)

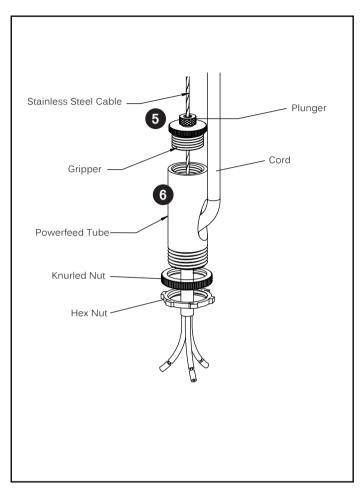


Step 5

Insert the cable through the gripper and plunger. Trim off extra cable using cable cutting tool.

To adjust the cable to desired length, press the plunger.

Step 6

Secure gripper with powerfeed tube, then feed cord through powerfeed tube.

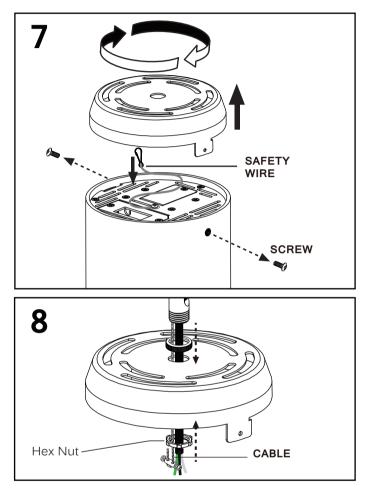

Step 7

Loosen two screws on the side of the fixture. Twist and lift up the lid from cylinder. Unhook the safety wire from cylinder to detach the lid .

Step 8


Slide powerfeed tube through lid and screw nuts on both sides of lid. Ensure powerfeed tube is securely fastened to lid.

METEOR LIGHTING P: 213.255.2060 F: 213.596.3704 www.meteor-lighting.com

INC04A01-17V4 | Page 2 of 3

*METEOR LIGHTING reserves the right to make changes to this product at any time without prior notice and such modification shall be effective immediately.

ADVANCED HIGH CEILING METE QR 4" Cylinder Series - Adjustable Cable(0-10V / Triac)

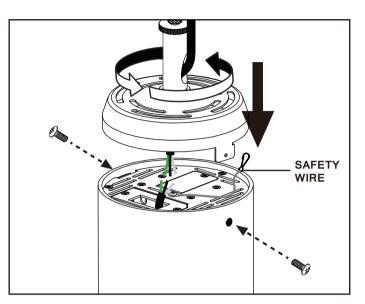

Step 9


Make appropriate wire connections, see Wiring Diagram for instructions.

* Make all connections with UL approved connectors.


Attach cylinder fixture to lid and hook safety wire on the lid .Secure by screws.

Wiring Diagram

STV & SPV

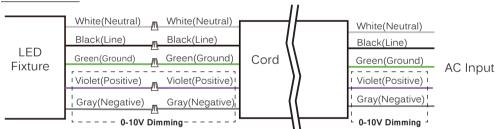

TRIAC

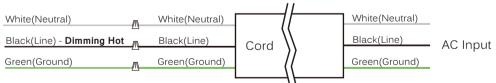

METEOR LIGHTING P: 213.255.2060 F: 213.596.3704 www.meteor-lighting.com

*METEOR LIGHTING reserves the right to make changes to this product at any time without prior notice and such modification shall be effective immediately.